If continuation sheet 1 of 5

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING: 01 COMPLETED HAL078083 B. WING 08/18/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1301 E. FOURTH AVENUE RED SPRINGS ASSISTED LIVING RED SPRINGS, NC 28377 (X4) (D SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG COMPLETE TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) C 000 Initial Comments C 000 Report of Biennial Construction Survey by Dennis Harrell on 8-18-20126. Records indicate this facility was first licensed on 10-8-1996, with a capacity of 81 beds. Therefore the facility was surveyed for conformance with the applicable portions of the 2005 Rules for Licensing of Adult Care Homes of Seven or More Beds, and applicable portions of the 1996 Edition, of the North Carolina Building Code(s), Institutional Occupancy, and the 1994 Minimum Standards and Regulations for Homes for the Aged in effect at time of initial licensure. C 101 Existing Licensed Fac- No less than '71 Rules C 101 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation at no cost; This Rule is not met as evidenced by: Based on observation, the Special (magnetic) Locking installed in 2006 fails to comply with Division of Health Service Regulation LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE Mitchell Moran Maintenance Director 9/29/16 STATE FORM

S01Z21

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION IDENTIFICATION NUMBER: (X3) DATE SURVEY A. BUILDING: 01 COMPLETED HAL078083 B. WING 08/18/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1301 E. FOURTH AVENUE RED SPRINGS ASSISTED LIVING RED SPRINGS, NC 28377 (X4) ID SUMMARY STATEMENT OF DEFICIENCIES ID. PRÉFIX PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY) C 101 Continued From page 1 C 101 Section 1003.3.1.8.5.e of the 2002 NC State Building Code. Section 1003.3.1.8.5.e requires an emergency release switch to be provided within 3 feet of each locked door. Finding includes: The emergency release switches provided were 1 Emergency release switches approximately 7 feet from the door and on a will be moved to within 3 10/14/16different wall. feet of locked door. Alarm Based on observation, the Special (magnetic) company has scheduled for Locking installed in 2006 fails to comply with Section 1003.3.1.8.5.c. Section 1003.3.1.8.5.c 10/14/16 requires a system components location map to be provided under glass adjacent to the fire alarm panel. Finding includes: There was no system components location map System components location provided under glass adjacent to the fire alarm 2 map will be provided and panel. 10/14/16 placed on wall at fire C 111 Must Have Current San. & Fire Safety Reports alarm panel. Alarm company C 111 will provide on 10/14/16 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION(f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: Based on a review of documents, the required annual fire alarm system inspection report could not be located. Fire alarm systems that are not inspected and approved as required could result in the fire alarm system not operating properly in the event of an actual fire.

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING: 01 COMPLETED HAL078083 B. WING 08/18/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1301 E. FOURTH AVENUE RED SPRINGS ASSISTED LIVING RED SPRINGS, NC 28377 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (X5) COMPLETE PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) C 166 | Continued From page 2 C 166 C 166 Housekeeping-Maintained Free of Hazards C 166 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards: (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: Staff has been trained 1 Based on interview, many staff were unaware of the purpose of the emergency release switches 8/30/16 on the purpose of the provided for the magnetically locked exit doors. emergency release switches Staff that are not properly trained about emergency egress procedures could delay or (copy of training sign in prevent an evacuation in an emergency. sheets attached) Based on observation, the facility was not maintained in a safe condition because of improper storage too close to a fire sprinkler head. Storage that is not kept at least 18 inches below the sprinkler head could negate the ability of the fire sprinkler system to extinguish a fire. Findings include: All items have been removed Items had been stacked all the way to the ceiling 2 and are 18 inches below in the maintenance shop. 8/23/16 sprinkler head Based on a review of documents, the range hood fire suppression system is not being Maintenance has and will 8/19/16 inspected monthly as required. Fire suppression 3 continue to inspected monthly systems that are not inspected may fail to operate properly in a fire. Based on observation, the ice machine drain. Ice machine drain has been line extends into the floor drain. Ice machine 9/8/16 fix to have the 2inches drain lines that are not maintained at least 2 inches above the floor or floor drain, as required

Division of Health Service Regulation

STATE FORM

above the floor/floor drain

PRINTED: 09/14/2016 FORM APPROVED

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING: 01 COMPLETED HAL078083 B, WING_ 08/18/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE RED SPRINGS ASSISTED LIVING 1301 E. FOURTH AVENUE RED SPRINGS, NC 28377 (X4) ID SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION PREFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL (X5) COMPLETE PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY) C 186 Continued From page 3 C 166 by Code, could cause the ice to become contaminated. C 185 Fire Safety-Rehearsals on Each Shift C 185 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0309 PLAN FOR EVACUATION (b) There shall be rehearsals of the fire plan quarterly on each shift in accordance with the requirement of the local Fire Prevention Code Enforcement Official. (c) Records of rehearsals shall be maintained and copies furnished to the county department of social services annually. The records shall include the date and time of the rehearsals, the shift, staff members present, and a short description of what the rehearsal involved. (f) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: Fir Drill document Based on a review of documents, most of the 1 has more description 9/2/16 records available onsite included no description of what the rehearsal involved. (copy is attached) C 189 Building Equipment Maintained Safe, Operating C 189 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. Division of Health Service Regulation

Division of Health Service Regulation FORM APPROVED STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING: 01 COMPLETED HAL078083 B. WING. 08/18/2016 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 1301 E. FOURTH AVENUE RED SPRINGS ASSISTED LIVING RED SPRINGS, NC 28377 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION PRÉFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) COMPLETE TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) Continued From page 4 C 189 This Rule is not met as evidenced by: Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: a. Hole in the ceiling of the lobby, all holes was filled with b. Hole in the ceiling of the RCC office. a-d 8/26/16 Fire stop caulking c. Holes in the ceiling of the Activity office, d. Holes in the wall and ceiling of the laundry on A Hall. e. Sprinkler escutcheons were missing or not tightly fitted to the ceiling to maintain the fire all sprinkler escutcheons resistance in the following locations; 8/25/16 replace if missing or i. Bathroom off the Admin office, adjusted to fit tightly to Lobby (2), iii. Activity office, ceiling iv. A Hall corridor. Based on observation, many corridor doors are prevented from closing quickly and latching to resist the passage of fire and smoke. Corridor doors that do not close completely and latch present the possibility that a fire that begins in one space can quickly spread to the corridor and the remainder of the facility. Findings include: a. The door to bedroom D-21 would not latch door was adjusted to latch | 9/1/16 а when closed doors was adjusted to stay b. The doors to bedrooms B- 23, C-11, and D-3 9/1/16 b were propped open. open There was a hole through the dining room C a plate was add to latchset 9/1/16 door at the latchset. There were several holes through the door to holes was filled in

Division of Health Service Regulation

the RCC office.

S01Z21

9/1/16



Training Record

Date of Training/Meeting: 8/30/16 Time: 2pm
Instructor/Supervisor: _Constantina Dutch
Comments: _ Door Release Switch
Stoff Name and City
Staff Name and Signature:
1. Daisi huaga amasa
2. Carolys McCarlum Clocklyn
3. SAMOS Milyon J. Mcheal
4. Holandon Douglas Holalan DAC
5. Jewiter Bullard Gunnil Bull
6. James Clardie
7. Prayshana leve Kayshana Ser
8. Charrita Westfield Charta (elesfula) 9. Merita Westfield Alasit (de la designa)
The second the watered
11. Shakara Middlotan S. Mari
12. Amarda Brows Amara, Brown
13. ROSE Chavis Profile
14. Debra Ray Dehra Kan
15. Deidra Taylor Weight Taylor
16. Tannie Jacobs Damie In
17. ERCRO Thomas Elicia Thomas
18. Duna Flores Dean Flores
19. Bevery Elliat BrEcaio
Gesteine farley



Training Record

Date of Training/Meeting: 8/30/16 Time: 2pm	
Instructor/Supervisor: _Constantina Dutch	
Comments: _ Door Release Switch	
Staff Name and Signature:	
no A	In () 1.
+ 1	Alle (John
2. Chamain Marroe	Shamain Mohere
3. Brandy Locateor	B dockles
4. Braderick McRae	B MHALL.
5. Tracy Oxerdine	Truey & Ohch
6. Kendrick Bartey	Kendrick Bartes
7. yournah French O	if French
8. Cabrielle Opendine	A- Grenalino
9. Shera Clork	Shere Clork
10. Amy Pería	april Delia
11	
12	
13	
14	
15	
16	
17	
18.	

FIRE DRILL SCHEDULE (Drills must be conducted once a quarter on each shift)

Name of Adult Care Home: 12.5.A.
Address: 1301 E. CHA Are. Red Spring NC 2830
Date of rehearsal: 9-2-16 Time of rehearsal: 8 200 Shift 1st Cod 3rd
(Circle any that apply)
Other staff members present: Halanda Dauglas Teanis
James Mican Tosa:
Time for evacuation: didn't evacuate
Areas covered: (chéck any that apply)
Fire extinguishers instructions Fire alarm operation
Fire evacuation maps Discuss fire hazards to look for
Other:
** ***********************************
Date of rehearsal: Q-10-10 Time of rehearsal: Qan Shift(1st) and 2rd
Person in charge: Constantive Olatha (Circle any that apply)
Other staff members present: Om Paia Charita
Solve Sur Marinda Carried
Time for evacuation: dishit evacuate
Areas covered: (check any that apply)
Fire extinguishers instructions Fire alarm operation
fire evacuation maps Discuss fire house fire
Other: Retransal arrowned; head count, localized five area
Jave area